

TELECOM MAIN GROUNDING BUSBAR



CERTIFICATIONS



FEATURES

Meets TIA-607-C and TIA-607-D and conforms to BICSI® recommendations

Complies with NEMA® standards

Accepts two hole lugs with 5/16" or 7/16" bolt holes (hardware not included)

Telecom grounding busbar splice kits are available to extend the length of the busbar

SPECIFICATIONS

Thickness (T): 6.35mm
Width (W): 101.6mm
Material: Copper

Table 1/2


Catalog Number	Length 1 (L1)	Length 2 (L2)	Tin Plating	Hole Size 1 Number of Pairs	Hole Size 2 Number of Pairs	C
TMGBA12L15P	305mm	229mm	No	15	3	15.9mm
TMGBA12L15PT	305mm	229mm	Yes	15	3	15.9mm

Catalog Number	Length 1(L1)	Length 2(L2)	Tin Plating	Hole Size 1 Number of Pairs	Hole Size 2 Number of Pairs	C
TMGBA16L19P	394mm	229mm	No	19	3	15.9mm
TMGBA16L19PT	394mm	229mm	Yes	19	3	15.9mm
TMGBA18L23P	451mm	229mm	No	23	3	15.9mm
TMGBA18L23PT	451mm	229mm	Yes	23	3	15.9mm
TMGBA20L27P	508mm	229mm	No	27	3	15.9mm
TMGBA20L27PT	508mm	229mm	Yes	27	3	15.9mm
TMGBA24L33P	610mm	457mm	No	33	5	15.9mm
TMGBA24L33PT	610mm	457mm	Yes	33	5	15.9mm
TMGBA29L41P	737mm	457mm	No	41	5	15.9mm
TMGBA29L41PT	737mm	457mm	Yes	41	5	15.9mm

Table 2/2

Catalog Number	B	A	D	Hole Size 1 (HS1)	Hole Size 2 (HS2)
TMGBA12L15P	28.6mm	25.4mm	15.9mm	0.3125in	0.4375in
TMGBA12L15PT	28.6mm	25.4mm	15.9mm	0.3125in	0.4375in
TMGBA16L19P	28.6mm	25.4mm	15.9mm	0.3125in	0.4375in
TMGBA16L19PT	28.6mm	25.4mm	15.9mm	0.3125in	0.4375in
TMGBA18L23P	28.6mm	25.4mm	15.9mm	0.3125in	0.4375in
TMGBA18L23PT	28.6mm	25.4mm	15.9mm	0.3125in	0.4375in
TMGBA20L27P	28.6mm	25.4mm	15.9mm	0.3125in	0.4375in
TMGBA20L27PT	28.6mm	25.4mm	15.9mm	0.3125in	0.4375in
TMGBA24L33P	28.6mm	25.4mm	15.9mm	0.3125in	0.4375in
TMGBA24L33PT	28.6mm	25.4mm	15.9mm	0.3125in	0.4375in
TMGBA29L41P	28.6mm	25.4mm	15.9mm	0.3125in	0.4375in
TMGBA29L41PT	28.6mm	25.4mm	15.9mm	0.3125in	0.4375in

DIAGRAMS

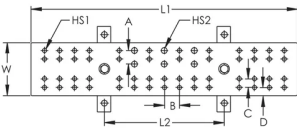

WARNING

nVent products shall be installed and used only as indicated in nVent's product instruction sheets and training materials. Instruction sheets are available at www.nvent.com and from your nVent customer service representative. Improper installation, misuse, misapplication or other failure to completely follow nVent's instructions and warnings may cause product malfunction, property damage, serious bodily injury and death and/or void your warranty.



Our powerful portfolio of brands:
nVent.com CADDY ERICO HOFFMAN RAYCHEM SCHROFF
TRACER